

Copyrights and Limitations

- This presentation is conceptual and intended to be presented by GHL. Application of concepts to a specific project must be confirmed by a specific GHL/client agreement.
- This presentation is copyright GHL Consultants Ltd and others and all rights are reserved.
- Note: GHL has prepared this presentation to assist the design community based on our review and understanding of the 2024 BC Building Code changes. This presentation should be distributed and reviewed in its entirety. We take no responsibility for accuracy or completeness unless we are specifically retained to participate in a project, and related to the specific project scope. We are happy to provide proposals for assistance on your project, please contact tech@qhl.ca.

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Code Reference	Comments	
code Reference		
	Bold sidebars are the differences between BC and NBC.	
	Light sidebars are the changes to the NBC.	
	Changes from 2018 to 2024 are not marked.	
Division a Part 1	New official definition of ramp: a path of travel having a slope steeper	
1.4.1.2.(1)	than 1 in 20.	
	Definition of post-disaster revised to add reference to determination by	
	the authority having jurisdiction.	
Division B Part 1	Consider and an Innetional in Anti-land 4.4.2.2 have been deleted	
Former 1.1.3.3	Specific radon locations in Article 1.1.3.3 have been deleted.	
Division B Part 1	Remember to: check Table 1.3.1.2 for updates to editions of referenced	

Code changes have previously been marked to show both the difference between the BC and the NBC and the difference between the current Code and the previous edition.

Post disaster – the intent is that this makes it easier for the AHJ to determine, as it is based on how they plan to use the building or facility, not simply whether the type of building or facility is on a list in the definition.


Radon – the Code previously included a list of locations with potential for radon, now it requires review for whether radon is an issue, everywhere.

Things to Note


Code Reference	Comments
	Things have been moved or rearranged without change:
	Subsections 3.1.6 (tents) and 3.1.18 (EMTC) have been switched; tents is now 3.1.18 and EMTC is now 3.1.6.
	Articles in Subsection 3.2.2 that were unique to BC: 3.2.2.48EMTC and 3.2.2.57EMTC renumbered 3.2.2.48 and 3.2.2.57. Subsequent articles from 3.2.2.49 to 3.2.2.56 changed by one and articles from 3.2.2.57 to 3.2.2.92 changed by 2.

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.




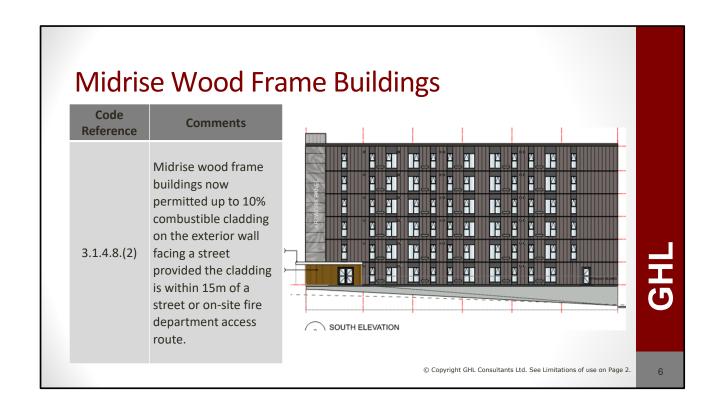

This allows for a little decorative wood at the building face at the street where the fire department can see it and get at it.

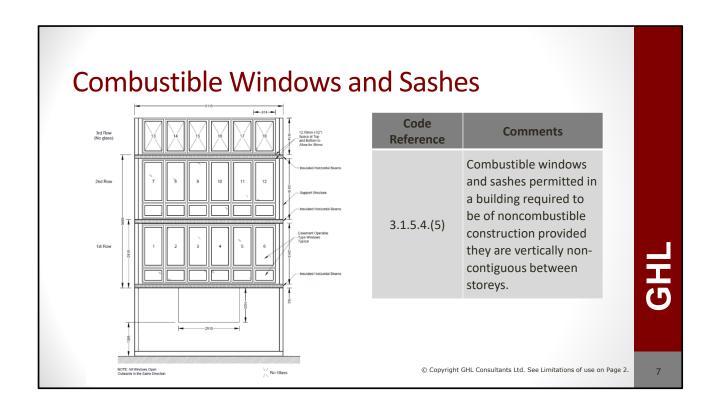

This change is the result of fire testing and based on the test report, the intent in the wording *vertically contiguous* is to permit individual windows provided they do not touch each other.

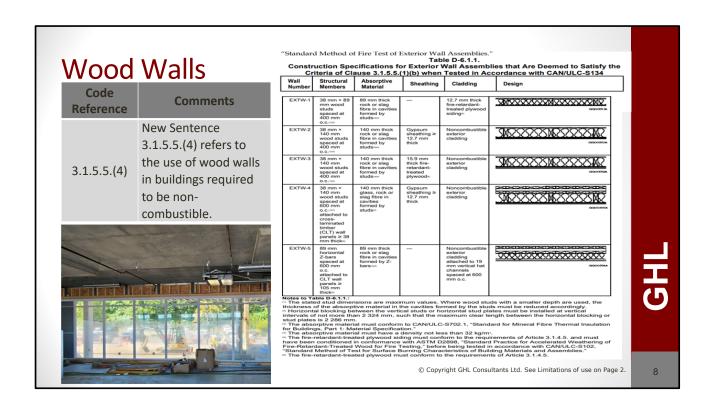


It is now possible in buildings required to be of noncombustible construction (i.e. the structural elements are noncombustible) to have nonloadbearing infill exterior walls of wood framing.




Previously 3.1.8.3 was a generic requirement to make a 'smoke-tight' joint at the juncture of fire separations: wall to wall, wall to floor, wall to roof.

2024 3.1.8.3.(3) requires the continuity is maintained at joints using a tested firestop having an FT rating the same as the fire separation.

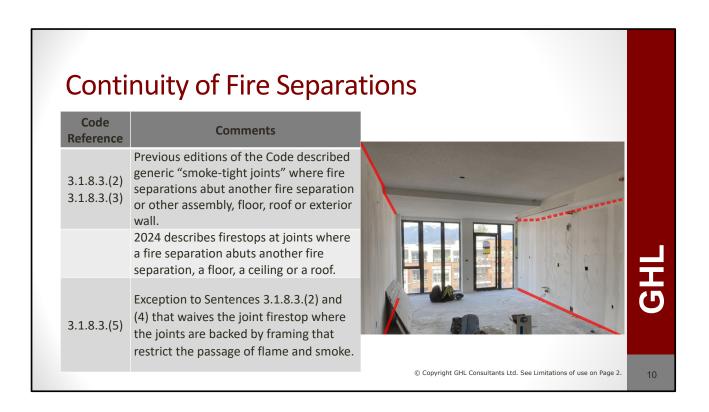


The exception applies to wood framing as the joints are inherently backed by top and bottom plates and backing at corners, steel stud assemblies and assemblies using resilient channel need closer review.

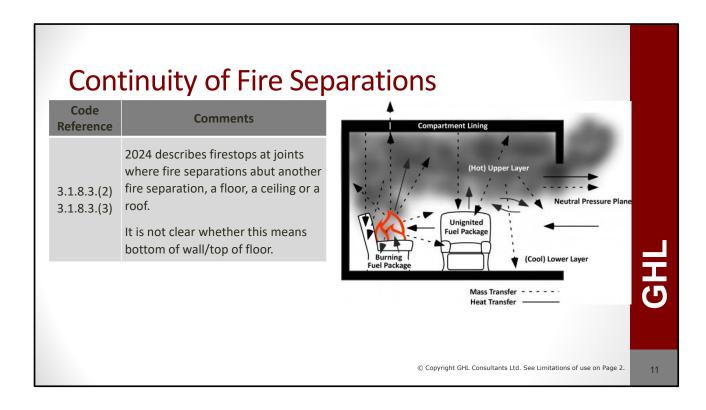

It's not entirely clear whether the firestop is required at the joint only at the underside of floor or topside (wall to floor) or both, some firestop listings show both, the joint at the topside is not as much of a concern.


The concern is with heat and smoke at the upper half of the room, the hot layer, the joint between the bottom of the wall and the top of the floor is not the weak point in the fire separation.

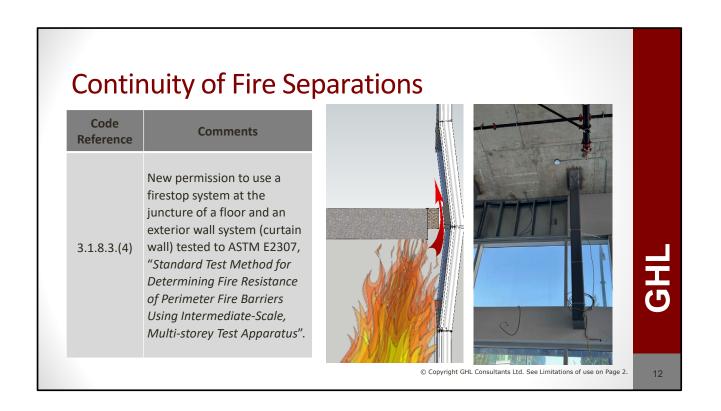

The ASTM tested firestop systems are proprietary, they determine which curtainwall system can be used, it is likely these still require alternative solutions or engineering judgements.

Wired Glass and Safety Glazing	
Code Reference	Comments
Table 3.1.8.17 Articles 3.1.8.17, 3.1.8.18 and 3.1.8.19.	Added 'or safety glazing' to wired glass in Table 3.1.8.17 <i>Restrictions on Temperature Rise and Glazing for Closures</i> , and the exception in Article 3.1.8.19. Does not change the requirement for a fire resistance rating at the exit enclosure (result is fire-rated safety glazing)
	© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

The permission to use safety glazing (tempered or laminated) where wired glass is permitted does not negate the requirement for fire protection rating. In order to make this work you need fire rated safety glass.

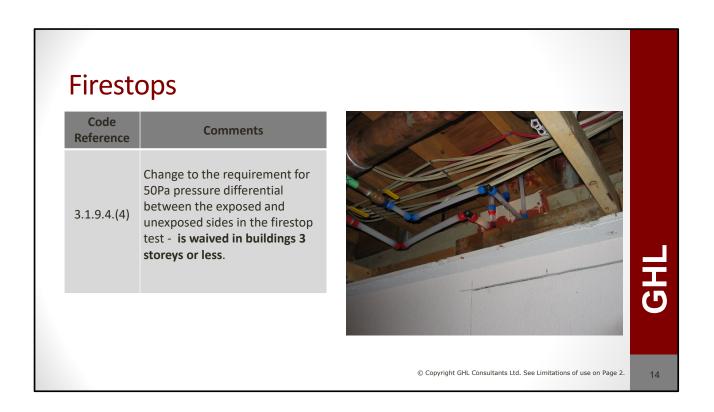


The Code previously required the 50Pa pressure differential in the firestop test for all combustible water distribution pipe in Sentence (2) and combustible DWV pipe in Sentence (4). The additional test requirement for pressure differential now applies only in buildings more than 3 storeys.

Combu Code Reference	stible to Noncombustib	e Pipe Transitions	
3.1.9.4.(7)	New sentence clarifies that transitions between combustible and noncombustible pipe are permitted above/below a horizontal fire separation and describes requirements for firestops. Not previously addressed in the Code.	Not required	
			GFI
		© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.	15


The rationale with the change to NBC describes the addition of permissions to use combustible pipe based on the reference to (7) and (8) in Sentence 3.1.9.4.(3).

The Code always permitted transitions between combustible and noncombustible drain, waste and vent (DWV) pipes at vertical fire separations under Sentence 3.1.9.5.(5). It did not address transitions between combustible and noncombustible DWV pipes at horizontal fire separations, which has caused inconsistent field interpretations and led to several interpretations being issue by the BC Building Code Interpretations Committee, dating back to 1998.

The change clarifies that transitions are permitted.

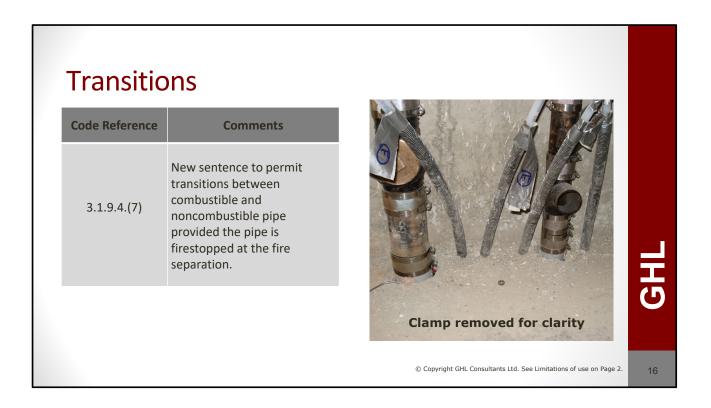

Transitions between plastic and metal pipe are permitted at horizontal fire separations/rated assemblies...provided they are firestopped. The plastic DWV pipe in the photo is firestopped at the underside of the floor and the transition made immediately at the top of the floor (see slide 22 for explanation). This addresses, for example, the typical plastic pipe in the parking garage and metallic pipe in the wood-frame building above. The firestop is located at the underside of the floor and is a system designed for use with plastic pipe.

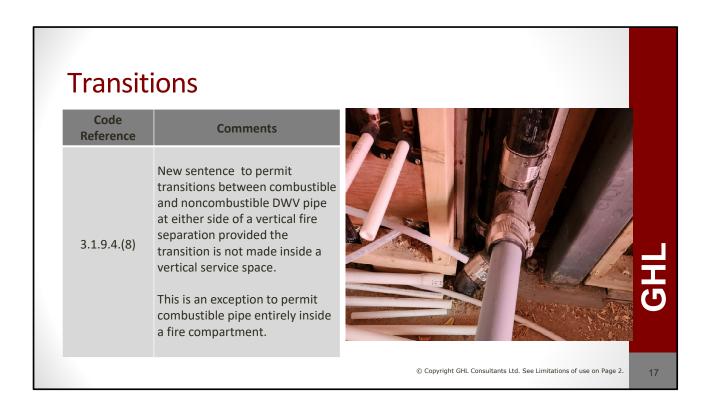

Sentence (8) is an exception to (7) and Sentence (7) is a requirement for firestopping, thus in the scenario in Sentence (8) firestopping is not required. This is not a riser in a fire separation, it is a riser in a partition wall inside a suite and thus, the riser is firestopped, and fire contained, at the floor above and below.

Based on the note (8) describes a metallic riser in a partition wall inside a fire compartment and plastic trap arms and fixture drains between the riser and the fixture.




© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Fire Alarm Audible and Visible Signals

Code Reference	Comments
3.2.4.18.(6)	New requirement for audibles to emit low frequency signals in sleeping rooms in residential and care occupancies.
3.2.4.19.(1)	Added Clauses (e), (f), (g) and (h). New locations for visible signal devices (strobes): (e) in public corridors in B, C, D, and E occupancies (f) in corridors used by the public in assembly occupancies (g) in 10% of suites in a hotel or motel (h) in public washrooms

Low frequency audibles address occupants with hearing loss.

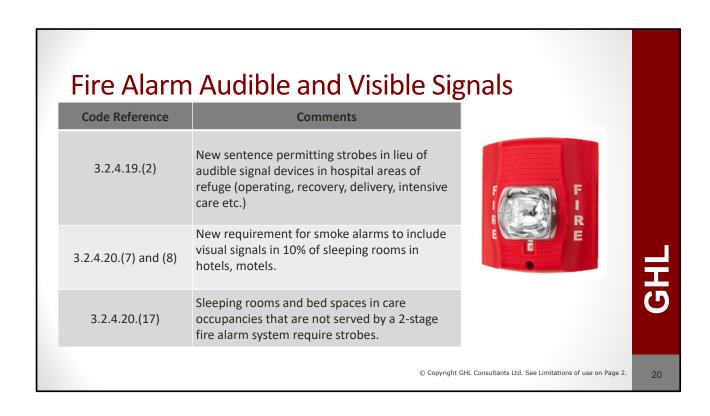


Articles 3.2.4.18 (audible signals) and 3.2.4.19 (visual signals) significantly rearranged.


These sleeping rooms are not bedrooms in dwelling units, they are rooms in dormitories, boarding houses, shelters, work camp accommodation etc.

Code Reference	Comments
3.2.7.1.(4) 3.2.7.1.(5)	 Normal light level increased from 50 to 100 lx at: the entire length of escalators and movators controls in 3.8.2.6. (thermostats, faucets, door and window hardware, intercoms, electrical outlets used by occupants) except controls that are internally illuminated and light switches.
3.2.7.1.(6) 3.2.7.1.(7)	Normal light level increased from 50 to 200 lx at: visual information (signs) at controls in (5) horizontal exits, maglocks, crossover, floor numbers, stair numbers and all signs for accessibility.

The increase in minimum light levels is unlikely to create a need for additional lighting as the previous minimum of 50lx is much dimmer than typical lighting in buildings.

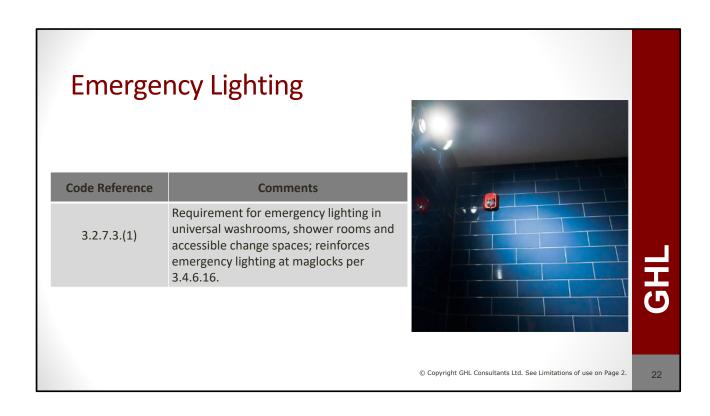

The Code previously said public washrooms, now says both public washrooms and universal washrooms.

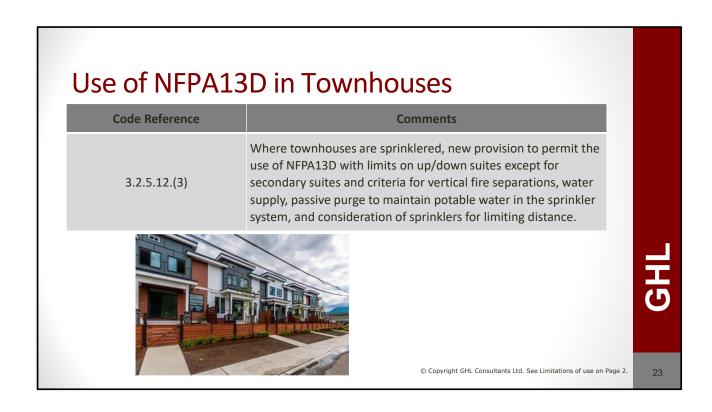

This allows the use of NFPA 13D instead of 13R in side-by-side townhouses. There are specific requirements for fire separations and the sprinkler system design and if the sprinkler system is used to address exposure to property lines or other buildings, then all rooms at that building face must be sprinklered, even if 13D says not.



Code Reference	Comments	
	Relocated Tactile Walking Surface Indicators to 3.3.1.19.	
3.3.1.19.(1)	Tactile warning indicators are to comply with Clauses 4.3.5.3.1, 4.3.5.3.3 and 4.3.5.3.4 of CSA B651, 'Accessible Design For The Built Environment' and be provided at the top of flights of stairs that are unenclosed and at drop-off edges with a change in elevation greater than 300mm unless protected by a guard.	
	Note A-3.3.1.19.(1): clarifies applies to stairs in open spaces, stairs from mezzanines, and stairs that are not separated from the floor area by a door or gate; transit platforms and reflecting pools are example of drop off edges.	

Clarification that enclosed exit stairs do not require tactile indicators (this is not a change; it is a clarification).


Wired Glass		
Code Reference	Comments	
3.3.1.20	3.3.1.20 still references CAN/CGSB 12.11M (1990) for 'wired safety glass' as an option.3.3.2.17 is unique to assembly occupancies.	
		GHI
	© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.	26

Wired glass is still required in all the locations it used to be in occupancies other than assembly. The standard in this article is from 1990 and it does include wired glass.



THE CHANGE IS SUBTLE – Article 3.3.1.20 still refers to the old CGSB standard for safety glass that includes wired glass.

3.3.2.17 is specific to assembly occupancies and does not reference the same CGSB standard, the standard in this article does not include wired glass.

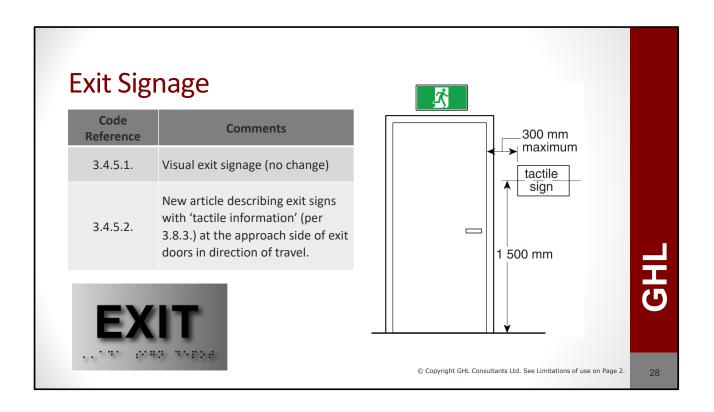


There are 2 exit signs: one visual and one tactile.

E C E

Signage at Exit Stairs

Code Reference	Comments
3.4.6.19	New requirement for floor number and stair designation signage to be: mounted permanently on the wall on the stair side and on the floor area side at the latch side of doors to exit stairs use upper case letters indicating the designation assigned to each exit stair both visual and tactile forms in accordance with Subsection 3.8.3.

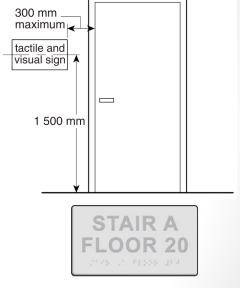

@ Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Handrail Dimensions

Code Reference	Comments
3.4.6.5.(5)	Changes to dimensional (cross section) requirements for handrails: a) Circular maximum allowable diameter increased from 43mm to 50mm (changed from 30-43 to 30-50) b) Non-circular maximum perimeter increased from 125mm to 160mm and cross-sectional dimension from 45mm to 57mm.

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Ramp Slope		
Code Reference	Comments	
3.4.6.7.(1)	Change to ambulatory ramp slope: maximum ramp slope is 1:12 except in industrial occupancies.	
3.4.6.7.(2)	Ramp slope in industrial occupancies is 1:6 for interior ramps and 1:10 for exterior ramps.	=
3.4.6.7.(3)	Criteria for curb ramps in 3.8.3.4.(1). CSA B651 "Accessible Design For the Built Environment"	9
	© Copyright GHL Consultants Ltd. See Limitations of use on Pag	e 2. 3

The design criteria for curb ramps is not described in Section 3.8, it is all in CSA B651.


GHL

Maximum Bevel on Stair Nosing

Code Reference	Comments
3.4.6.8.(8)	Change to maximum bevel on stair nosing from 10mm to 13mm. (6mm – 10mm now 6mm – 13mm)

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.



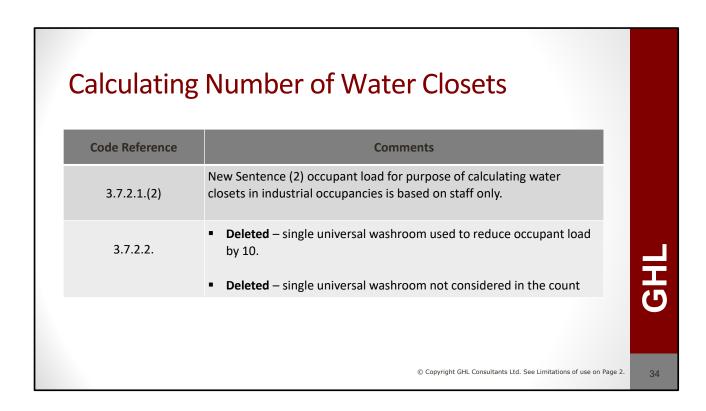

Previously industrial occupancies required large numbers of water closets based on factories, many other buildings (like F2 self storage) have very low occupant loads.

That a single universal washroom was not counted was unique to BC, now they are counted.

GHL

Areas Requiring Access

Code Reference	Comments
3.8.2.1. 3.8.2.3. 9.5.2.	Moved exception for apartments and condominium buildings. 3.8.2.3.(2) and 9.5.2. Provision for non-accessible apartment buildings limited to 2 storey buildings with an inaccessible storey with up to 600m² floor area.
3.8.2.2.(1)	Change to require accessibility at all pedestrian entrances to an accessible storey (except service entrances) – includes isolated suites. Sentence (2) exception for first storey (CRU) isolated suites is deleted.


© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Areas not Requiring Access

Code Reference	Comments
3.8.2.3.(2)	 Additions/changes to list of areas not requiring access: Small storeys (600m²) in two storey suites on any storey (formerly only first and second storey) not served by an elevator, platform passenger elevating device, escalator or inclined moving walk. Upper level of 2 storey residential suites (hotel, motel, etc. Parking levels without accessible parking spaces. Residential suites not designated by Code or authority having jurisdiction as accessible or adaptable. Small residential buildings not served by an elevator, platform passenger elevating device, escalator or inclined moving walk (this is on the previous slide).

Controls and Outlets


Code Reference	Comments
3.8.2.6. and 3.8.3.8.	 Controls for the operation of the building shall comply with Subsection 3.8.3 regardless of accessibility (except as required for elevators). Electrical outlets for general occupant use shall be located in conformance with Subsection 3.8.3

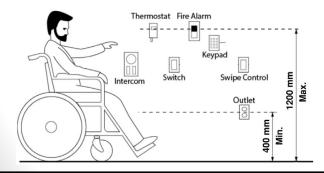


© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Controls and Outlets

Code Reference	Comments
3.8.2.6. and 3.8.3.8.	Minimum mounting height of controls has been reduced from 455mm to 400mm. Controls must be located in or adjacent to an accessible path of travel. Controls with a feedback signal must be visual and audible.

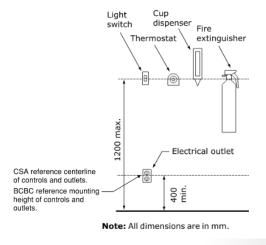

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

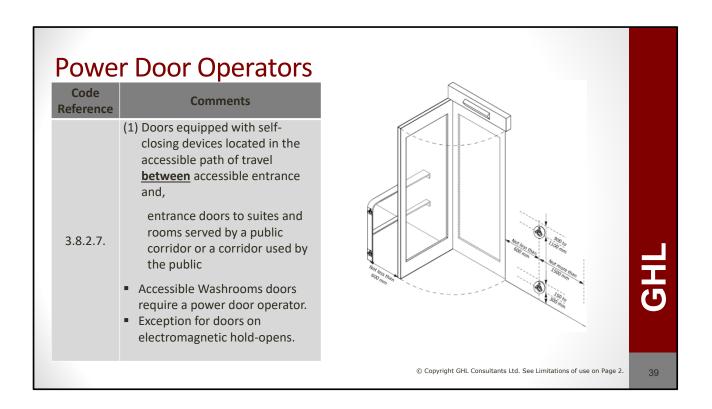


The requirement applies to doors on self-closers.

The exception applies to the same doors on hold-opens.

Doors and Doorways		
Code Reference	Comments	
3.8.3.6.(2)	Minimum clear width of door increased from 810mm to 850mm.	
3.8.3.6.(12)	Distance between doors in series (in vestibules in accessible path of travel) reduced from 1500mm to 1350mm.	
	© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.	


-> Minimum door width increased to 850mm. This standardized the door widths with the minimum widths of obstructions in Sentence 3.8.3.2(2).

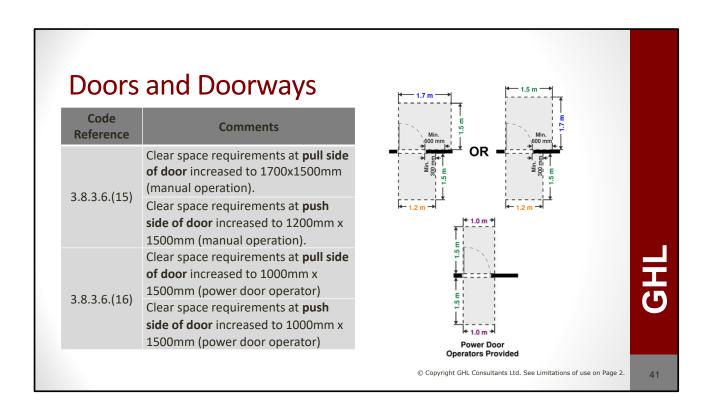

Dimension (300mm and 600mm) on the latch side of the door has not change.



© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

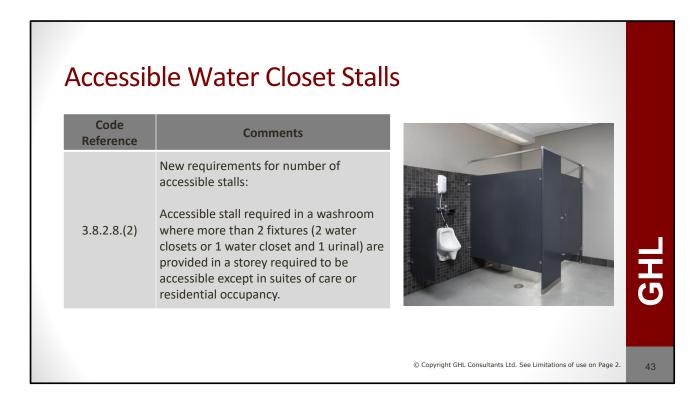


This is a change to how to determine whether accessible stalls are required in rooms with multiple fixtures, no longer determined by occupant load (2012) or by proximity to other accessible washrooms (2018).

됐

Accessible Water Closet Stalls

Code Reference	Comments
3.8.3.12.(1)	Clear space in front of stall increased from 1500mmx1500mm to 1700mmx1700mm. Clear lateral transfer space 1500mm long x 900mm wide. Door is aligned with the transfer space or a clear floor space not less than 1700mmx1700mm within the stall.

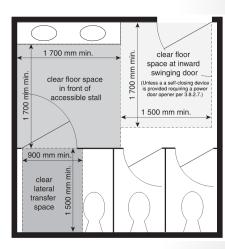


© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.


ADO = auto door opener.

Accessible Change Space

Code Reference	Comments
3.8.2.8.(15)	New requirement for accessible change space in a universal washroom on the main entrance storey in a building of A, B2 or E occupancy where at least one of the occupancies has an occupant load more than 500 persons. (This is an adult change table, see 3.8.3.13.(2) for design criteria)

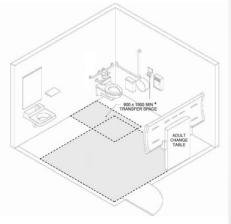


 $\ensuremath{\text{@}}$ Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

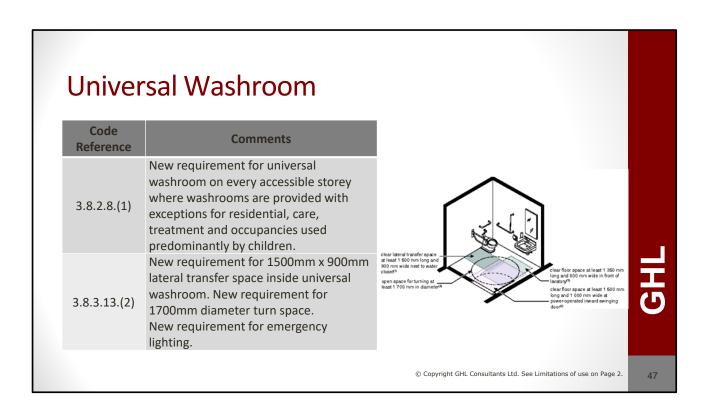

Code used to permit one universal washroom per building.

Now describes a universal washroom on each storey that is accessible and where washrooms are provided.

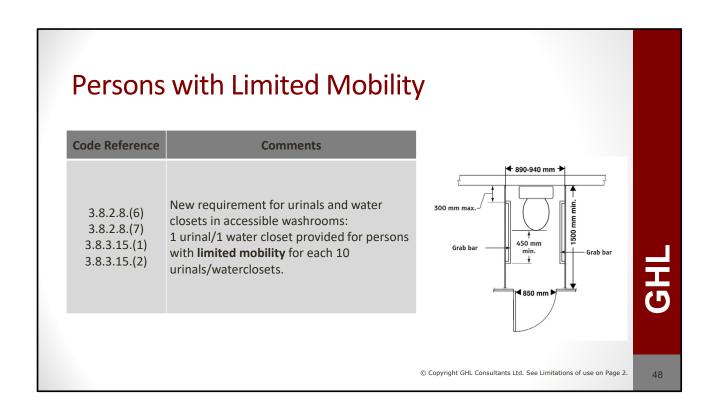


New kind of semi-accessible stall for persons with limited mobility.

One to 9 fixtures no limited mobility stall required.

10 to 19 fixtures one required.

21 to 29 fixtures 2 required etc...

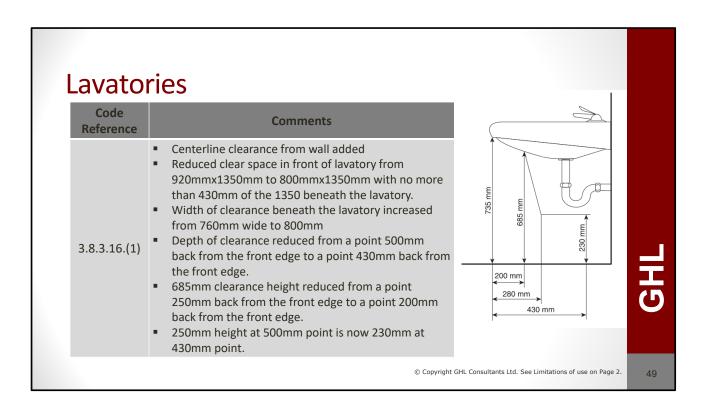

Requirement for center line to be at least 460mm from any wall has been added to the building code (was removed in the 2018).

Clear space requirements changes slightly (this diagram is in the notes in the Code).

Clear space in front of lavatory can include 430mm under (knee and foot space for wheelchairs is under the lavatory).


Bathtubs

Code Reference	Comments
3.8.3.18.(1)	Increased clear space at bathtubs from 1500mm diameter to 1700mm diameter.

GHL

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

50

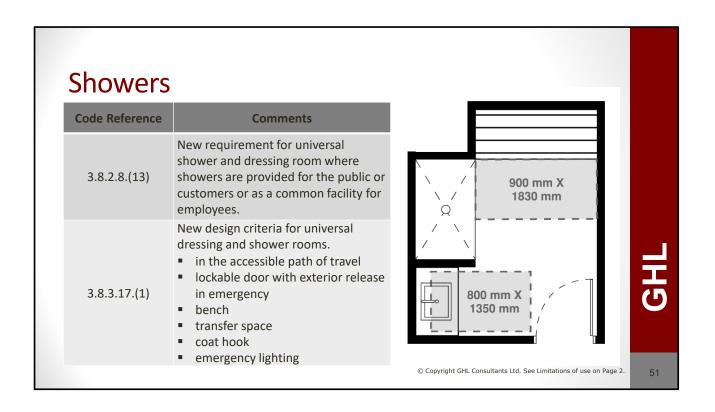


The bench is large: 760mm x 1830mm minimum.

The clear space is 900 x 1830 unless the bench is longer than 1830.


Seating in Assembly Occupancies

Code Reference	Comments
3.8.2.3.(4)	New Sentence requiring accessible spaces in waiting rooms with fixed seats.
3.8.2.3.(5)	New Sentence requiring adaptable seating in assembly occupancies with more than 25 seats.
3.8.2.3.(6)	New Sentence requiring an accessible path of travel to 5% of the adaptable seats.
3.8.3.22.(1)	New requirement for 1 in <i>every</i> 200 seats <i>in assembly occupancy seating areas</i> to be a permanent wheelchair space, the remaining accessible seats are permitted to be removable.
3.8.3.22.(4)	New requirement for storage of mobility aids on same level, in same fire compartment and near the adaptable seats.

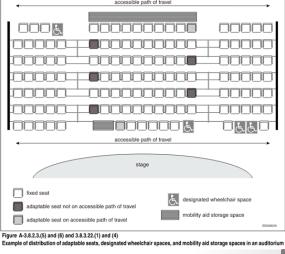


© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.


52

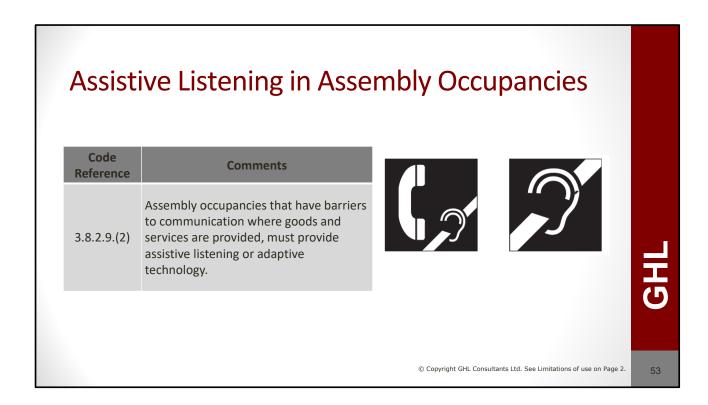

Applies in assembly occupancies only, where goods and services are provided to the public and there is a barrier to communication, such as concession stands, ticket booths.

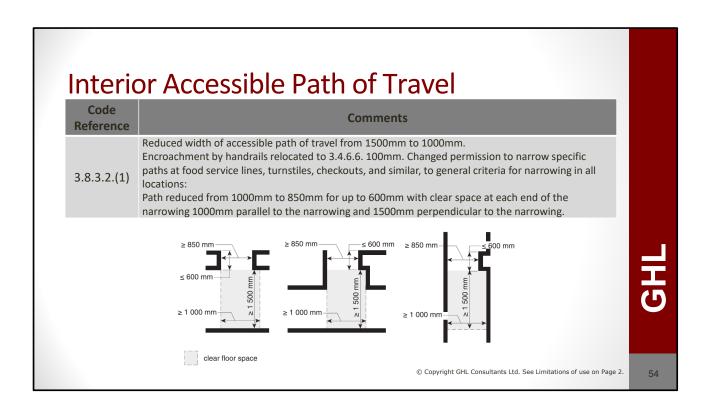

Defines the narrowing around columns etc. reduced to 850mm (same as a door) for a distance of 600mm.

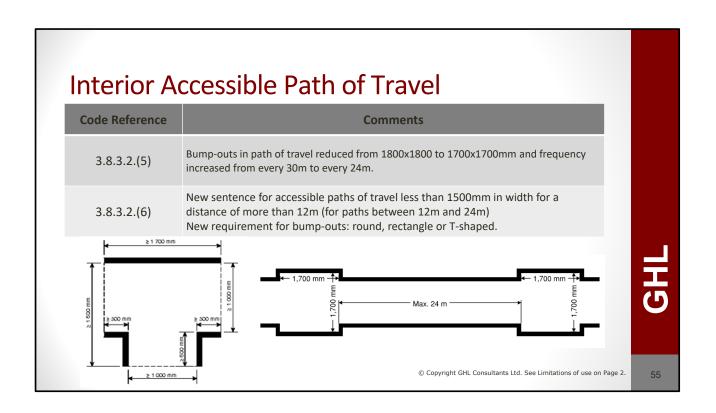


0-12m paths/corridors have no bump out.


12m to 24m paths/corridors need a turn around space at the ends.

Longer paths/corridors need bump outs every 24m.


Applies to portions of corridors (see GHL guide for diagrams).

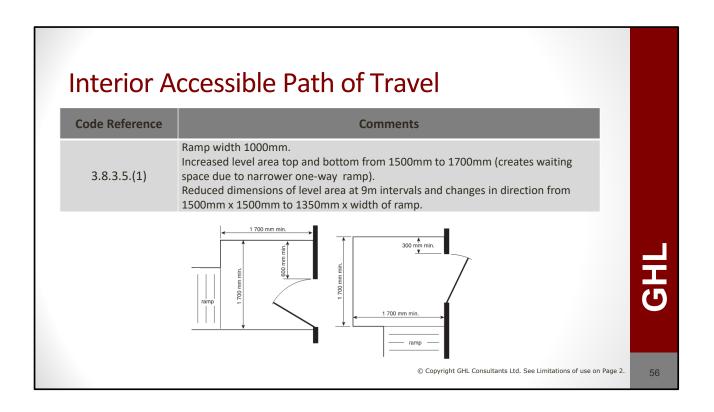

Narrower ramps and smaller intermediate landings and larger landings top and bottom for waiting (now assumes one-directional travel on ramp).

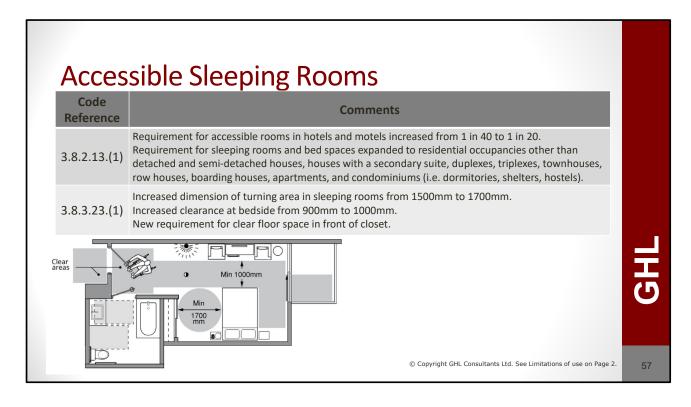


The accessible path extends to balconies.

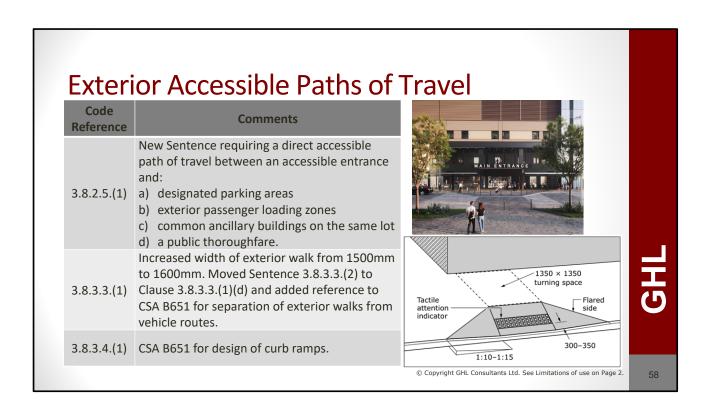


The requirement for an accessible path from the accessible entrance to the public thoroughfare (street) is a significant change and is potentially challenging on sloping sites.

Code Reference	Comments
3.8.3.9.(2)	Criteria for tactile information signs with requirement for Braille and raised tactile characters in accordance with CSA B651. Requirement for location of signs at latch side of door, 1500mm above the floor, 300mm from the door at: • washrooms • Crossover (inside stair)

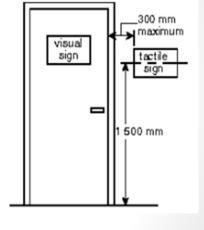




© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

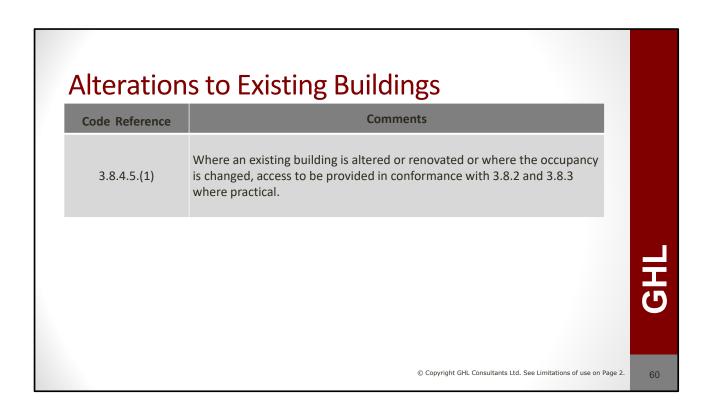

Code previously described access where persons with disabilities could reasonably be expected to work or to use the occupancy or building and where practical, now only says where practical.




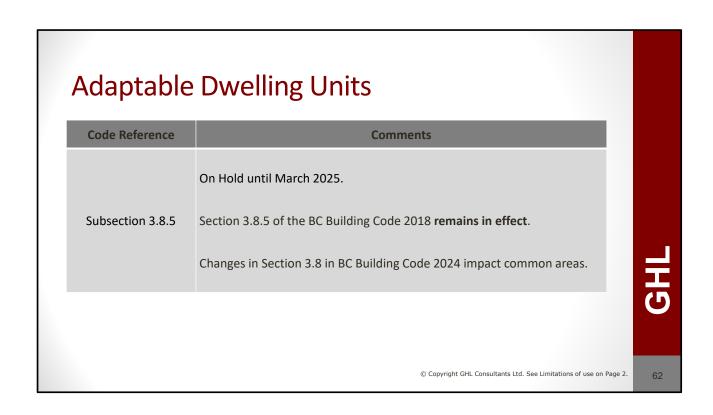


Requirement for 100% adaptable dwelling units and the design criteria for adaptable units is on hold until March 10, 2025.

Section 3.8.5 of the BC Building Code 2018 remains in effect and adaptable dwelling units are required based on local bylaws.

The changes in 3.8.2 and 3.8.3 for common areas do apply.

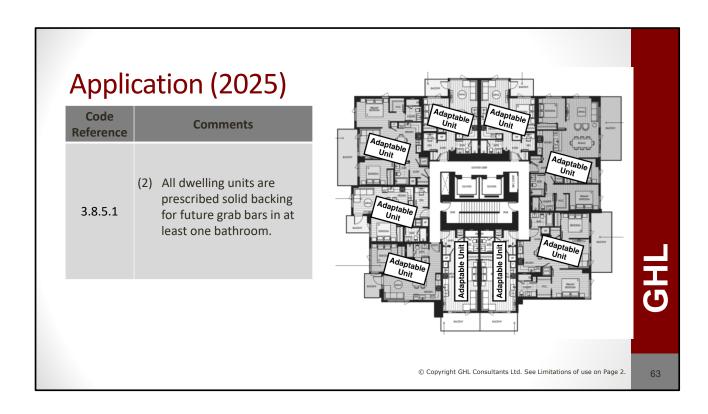

New article to require grab bars to be installed within a bathroom of dwelling unit (including dwelling units that are not required to be accessible or adaptable).

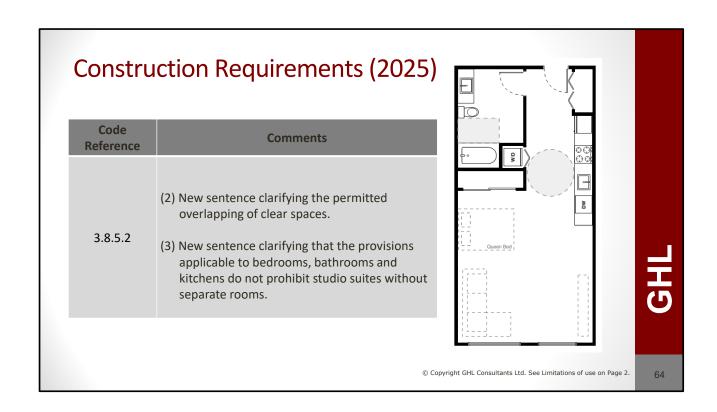


Clarification that clear floor spaces within adaptable dwelling units are permitted to overlap each other.

Clarification regarding that adaptable dwelling units are not required to have bedrooms, bathrooms and kitchens, but where these rooms are provided, they must meet the adaptable provisions. This is to enhance adaptability without limiting design options. (ie studio apartments).



Access from adaptable dwelling units to common areas, spaces, and facilities and all common exterior and interior paths of travel, and protected floor areas per Article 3.3.1.7 must be designed to Subsection 3.8.2


Clarification that common spaces and paths of travel that do not serve adaptable dwelling units need not be accessible (unless otherwise required in 3.8).

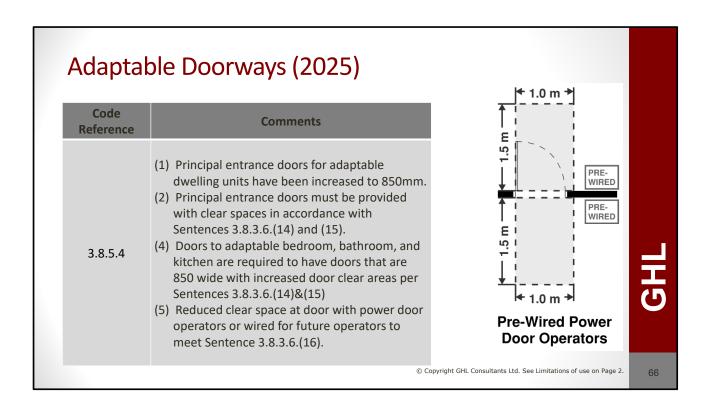


Harmonized with the door size increase to 850mm in the remainder of Section 3.8.

Accessible clear space requirements applies inside adaptable dwelling units.

Reduced clear space at door with power door operators or wired for future operators to meet Sentence 3.8.3.6.(16).

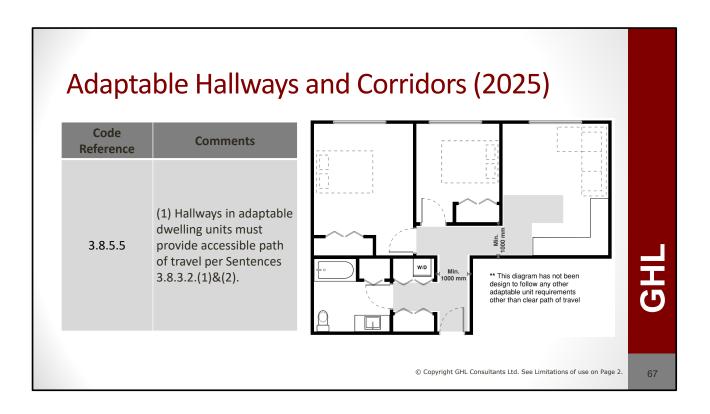


New design criteria for hallways inside adaptable dwelling units. This requires a minimum width of 1000mm and a reduced width of 850mm for not less than 600mm provided there is sufficient clear space at each end of the obstruction.

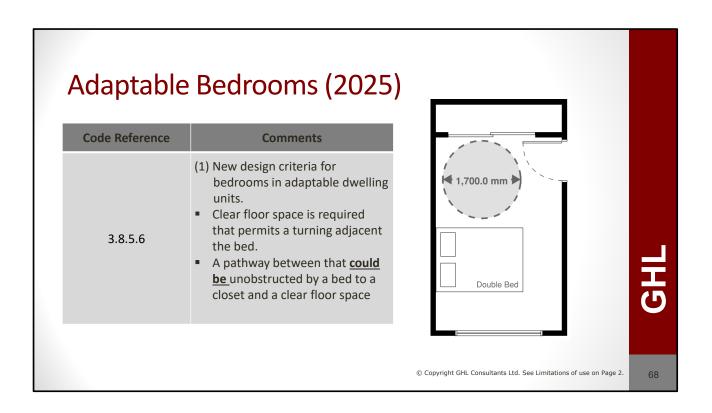


Harmonized with the clear floor space required for accessible sleeping rooms. This does not need to be provided it only need to be demonstrated how it would be possible to provide such as layout.

1700mm x 1500mm clear space or a turning diameter of 1700mm (850 wide unobstructed path around the bed).

-> Clear floor space of 1700mm x 1500mm in front of the closet

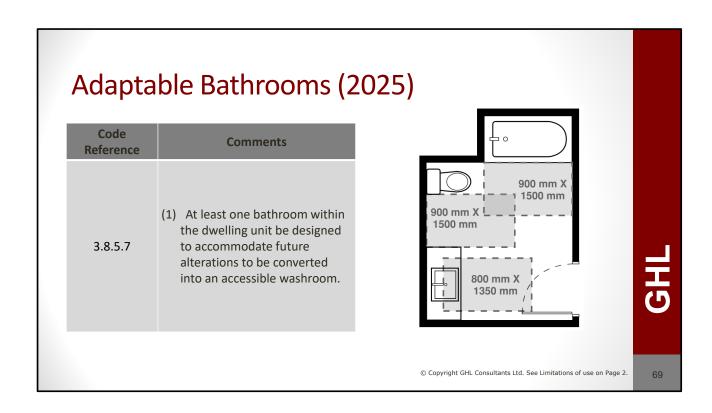

Most requirements for accessible bathrooms must be possible to achieve by modification of the washroom in future, not provided at construction. In the diagram a larger vanity with double basins could be provided at construction and the vanity changed to adapt the bathroom in future.

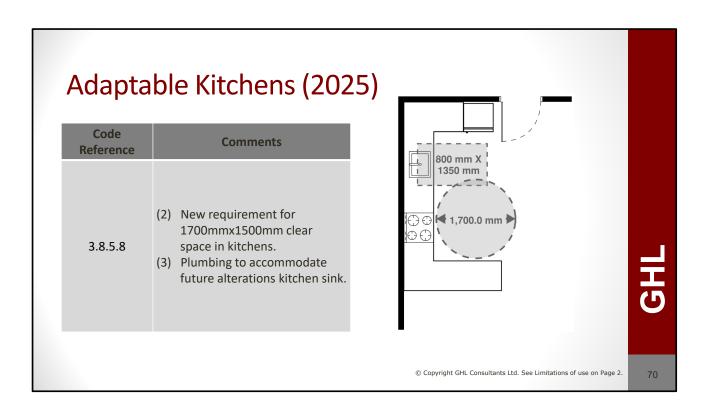


Must be possible to achieve by modification of the kitchen sink in future.



Changed height of controls from 455mm-1200mm to 400mm-1200mm (outlets nearer floor).

Clarification that requirements for controls exclude kitchen appliances, outlets above counter, hood fan etc.



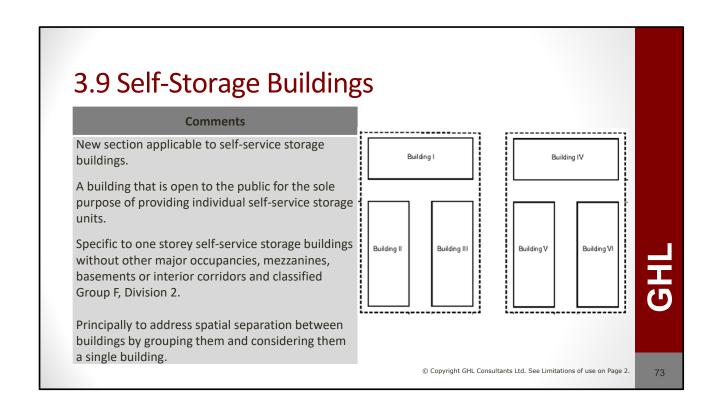

The Section includes permission to:

- combine building areas and apply Subsection 3.2.2 to a group of buildings to eliminate the requirement to address spatial separation between them in Subsection 3.2.3 subject to minimum distances between buildings and between groups of buildings.
- forgo an occupant load calculation.
- provide fire department access to a group of buildings.
- waive fire separations between storage units in unsprinklered buildings that are divided into fire compartments of up to 500m².

Self-serve storage warehouses that do not meet the criteria in Section 3.9 are still subject to Sentence 3.3.5.9.(1).



GHI

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Comments

Exemptions for small residential apartment buildings added here from

75

Accessibility

Code Reference

9.5.2.3

Section 3.8.

GF

Stairs, Guards and Handrails

Code Reference	Comments
9.8.4.9	Open risers now limited to interior and exterior stairs serving a single dwelling unit, a house with a secondary suite, service rooms, industrial occupancies (except storage garage), or are principally used for maintenance.

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Firestoppir	ng	
Code Reference	Comments	
9.10.9.2	Added joint firestops to continuity of fire separations (now same as Part 3).	
9.10.9.6 to 9.10.9.9	Firestopping piping penetrations and outlet boxes is the same as Part 3.	H
	© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.	77

Firestopping at penetrations and outlet boxes and joints is the same as in Part 3 now. Tested firestop S115. Firestopping in Part 9 used to be generic, now it requires tested systems.

Radon

Code Reference	Comments
9.13.4	Expands requirements to provide access for future installation or a rough-in for soil gas control or designed to Parts 5 and 6 to all buildings regardless of location, occupancy classification or extent of time occupied.

GHL

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

78

Part 9 Spatial Separation

Code Reference	Comments
9.10.14.1.(1)	Clarifies that 9.10.14 Spatial separation between buildings does not apply to detached carports conforming to Section 9.35 which serve a single dwelling unit or house with secondary suite (formerly reference only garages).
9.10.14.5.(4)	For a detached garage or accessory building serving one dwelling unit the exposing building face need not comply with cladding and construction requirements in Table 9.10.14.5.A regardless of limiting distance.
9.10.14.5.(11) and (12)	Replaces term 'public thoroughfare' with 'public way' which is an existing defined term (this is the section on eave protection).

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

Code Reference	Comments
9.10.15.2.(1)	Exposing building face may be divided into individual portions – Sentence no longer describes individual vertical portions. Except where the limiting distance is 2m or less, any portion with 2m or less limiting distance is calculated as a single building face.
9.10.15.4.(7)	New exception to application of 9.10.15.4.(1), to double permitted area of glazed openings in an exposing building face where the building is sprinklered provided rooms adjacent the exposing building face sprinklered regardless of NFPA exemptions.

Code has changed in several places to clarify that if you are using sprinklers to reduce LD then all the rooms on that building face need to be sprinklered. Because 13D would permit unsprinklered closets, bathrooms, garages etc.

Part 9 Structural Changes

Code Reference	Comments
Section 9.23	On Hold until March 2025.

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

81

Part 9 Cooling		
Code Reference	Comments	
9.33.2.	Adds Cooling Systems to Subsection 9.33.2; required for dwelling units intended for use in the summer months on a continuing basis unless determined to be unnecessary by Article 9.33.5.1 or good engineering practice according to Article 6.2.1.1. Sentence 9.33.3.1.(2) which prescribes temperature to be maintained in at least one living space in a dwelling unit (this is for safety, not for comfort).	
	© Copyright GHL Consultants Ltd. See Limitations of use on P	

This is an air conditioned room to provide a safe space in a heat wave it is not for occupants' comfort.

GHL

Part 6 Ventilation in Dwelling Units

Code Reference	Comments
6.3.1.1.(4)	Individual dwelling units with self-contained heating season mechanical ventilation systems must use Subsection 9.32.3 (used to say Part 6 OR 9.32.3, no longer refers to Part 6)

© Copyright GHL Consultants Ltd. See Limitations of use on Page 2.

